

JOB NO: 09035



Airfield Road, Christchurch, Dorset, U.K. BH23 3TG
Tel: 01202499400
25 JAN 2021

SERVICE REPORT

Ellesco Engineer: D Ketter
 Customer: Explomould
 ENG SER
 Contact: Kevin

Order No: VERBAL KEVIN, Machine Type: MCSB-900 Serial No: KP497-13

PART USED					
Description	Qty	Part No	Unit Price	Total Price	Replacement Sent

- M/C Service complete
- Mounted air regulator (main)
 - fitted new air regulator line in fitting
 - M/C not oscillating due to failed oscillation membrane valve
 - 4x Pinch rollers need replacement (0.35 deviation)
 - 3x V belts need replacement ASAP
 - Motor load readout failed.
 - M/C needs extraction
 - Conveyor belt split on beam
 - M/C air supply has too much liquid, suggest compressor service.
- * 1x Oscillation membrane valve * ASAP
 * 3x V belts → SPA 2207 Lw * ASAP
 * 4x Pinch rollers & bearings * ASAP
 * Motor load readout * ASAP

ACTION REQUIRED:
 * Conveyor belt *
 * Please quote above *
 (I.S.)

Date	Mileage Each Way	Chargeable Mileage	Travel Hours Each Way	Chargeable Travel Hours	Onsite Hours	Chargeable Onsite Hours	Overnight Accommodation
21/1/21	110		2hr 20		3 1/2		
1x 35024D @ £300.00.							
Service:			Spares:			Invoiced:	

Authorised Signature: C R. Smith Print Name: C R. Smith

